

Replace High Voltage (HV) Battery

Classification Campaign Bulletin Section/Group 16 - Battery Country/Region United States,

System

Canada

Year 2018 Model Model 3 Version **Dual Motor**

Bulletin Classification: This campaign bulletin addresses a known non-safety-related condition and provides recommended technical diagnosis and repair procedures. Apply this procedure to all vehicles in the affected VIN range listed. These instructions assume knowledge of motor vehicle and high voltage electrical component repairs, and should only be executed by trained professionals. Tesla assumes no liability for injury or property damage due to a failure to properly follow these instructions or repairs attempted by unqualified individuals.

Condition

The cooling tubes inside the HV battery were not brazed to Tesla's internal standards. This condition might result in a reduction of vehicle driving range.

Correction

Replace the HV battery.

Correction Description		Correction	Time
SB-18-16-017 Not Applicable		S011816017	0.0
Replace HV Battery Due To Cooling Tubes Not Bra	zed	S021816017	4.4

Required Part(s):	Part Number 1104422-00-M 1111033-00-D 1093060-00-A 1447684-00-A	Description ASY,HVBAT,E3,AWD,1PH,M3 M3 2R BOLSTER CLIP NUT&WSHR,M8,STL[9],DOUBLE SEMS BOLT,HF,M14-2.0x120,[109],ZNFL,SMAT	Quantity 1 2 2 2		
	Shop supplies: Shop towels HV insulating gloves Isopropyl alcohol (IF	s and leather outer gloves PA) wipes			
	These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the Parts Manual.				
Special Tool(s):	1020566-00-F 1020566-99-A 1129166-00-A 1134523-00-A 1140311-00-A 1053600-00-B 1130942-00-B 1132185-00-B 1133843-00-A 1135762-00-A GSN-TL-000564 1026636-00-A 1140501-00-A 1144879-00-A 1108272-00-B 1076921-00-B	ASY, Battery Table, Manual Lift Top Plate, Battery Table, Manual Lift Hoist, H-Frame Kit, Alignment Rods, Battery Lever Lock, HV Connector Drive Unit Pressure Test Fixture Adapter, Coolant Reservoir Pressure Test Kit, Coolant Leak Test Adapters Kit, Coolant Drain & Fill Adapters Kit, Svc Plug, Cooling Hose Kit, Battery Coolant Drain and Fill Pack Enclosure Leak Tester, HV Battery Pack Kit, Enclosure, Leak Test, HV Battery, Complete Kit, Encl Leak Test Adapters, HV Battery Cap, Logic Conn, Inv, 3DU Insulation Multimeter, Fluke 1507			
	1059330-00-B 1133569-00-A 1050448-00-A 1073363-00-A	Skt, 1/4in Dr, 5-Lobe Torx External Pliers, Clip Removal Refiller, Cooling System Gantry, Adjustable, Aluminum			

Procedure

Replace the HV battery (refer to Service Manual procedure 16010102).

Affected VIN(s) Affected Model 3 vehicle built on November 29, 2018.

NOTE: This is a simplified summary of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.

For feedback on the accuracy of this document, email <u>ServiceBulletinFeedback@tesla.com</u>.